



BEST MANAGEMENT PRACTICES PLAN
2025 ANNUAL REPORT



Photo Credit: Zack Wrzeszcz

Hecla Greens Creek Mining Company
February 16, 2026

Table of Contents

| | |
|--|---|
| 1. Introduction | 2 |
| 2. Comprehensive Site Compliance Inspections/Evaluations, Incidents of Potential Noncompliance and Associated Corrective Actions | 2 |
| 2.1. Monthly Site Compliance Inspections..... | 2 |
| 2.2. Agency Site Compliance Inspections..... | 3 |
| 2.3. HGCMC Monthly Evaluations and Site Inspections | 5 |
| 3. BMP Plan Modifications in 2021..... | 5 |

Attachments

Photographs

BMP Maintenance Log

1. INTRODUCTION

This 2025 Best Management Practices (BMP) Plan Annual Report is submitted by Hecla Greens Creek Mining Company (HGCMC) pursuant to Part 2.2.6 of Alaska Pollutant Discharge Elimination System (APDES) Permit AK-0043206, effective 1 October 2023. This report summarizes the scope and dates of the comprehensive site compliance inspections/evaluations, major observations related to the implementation of the BMP plan, corrective actions taken as a result of the inspections/evaluations, identification of potential incidents of noncompliance as they pertain to the BMP plan, and BMP plan modifications made during the year.

This report does not include a discussion of storm water discharges. Detailed information on storm events and water quality monitoring performed at permitted storm water outfalls is provided in the Storm Water Monitoring Program 2025 Annual Report, submitted to the Alaska Department of Environmental Conservation (ADEC) separately. A copy of the report is available upon request.

2. COMPREHENSIVE SITE COMPLIANCE INSPECTIONS

2.1. Monthly Site Compliance Inspections

Monthly storm water and BMP inspections were completed by HGCMC Environmental Department personnel. The inspectors have completed the Alaska Certified Erosion and Sediment Control Lead (AK-CESCL) storm water training program. The results of the inspections generally involved the need for maintenance activities to existing BMPs. Records of these inspections are retained on site and are available upon request. Items noted as deficiencies during the 2025 monthly inspections, as well as the corrective actions, included:

- During the March Inspection, it was noted that the seal for the SEAPRO Connex was missing. The seal was replaced the same day.
- During the April Inspection, the Spill Trailer was moved to 3.3 B-road to make it more accessible.

2.2. Sitewide Comprehensive Compliance Inspection

The sitewide comprehensive compliance inspection occurred on October 7, 2025.

The 2025 inspection found the following items:

- Vac out and remove veg under/around barge ramp
- Clean out boot vacuum area at Port Facility
- Clean drain near Hawk Inlet fuel island
- Replace large boom near FT-02
- Clean gnome pond near 3-mile B-road bridge
- Replace wattles below 3.4-mile bridge
- Resurface 3.0-mile B-road bridge
- Resurface 3.4-mile B-road bridge
- Maintain bear fence around Waste Rock Area E Pond
- Maintain check dams near 7.8-mile Culvert
- Vacuum out DB-01 and DB-02
- Install berm near east diversion ditch along mill back slope
- Clean sump near Portal entrance

- Maintain portal bridge
- Add additional labeling to portal spill kit.

The results from the sitewide comprehensive compliance inspection were managed in the summer/fall of 2025 (See photo 1 & 2 for examples).

Post inspection maintenance work:

- The barge ramp at Hawk Inlet was cleaned on 10/9/2025
- The boot vacuum at the port facility was tidied up on 10/9/2025
- Cleaning of the drain near the Hawk Inlet Fuel Island occurred on 9/24/2025
- The large boom near FT-02 was replaced in fall of 2025.
- Sediment removal from the gnome ponds at 3-mile B-road bridge was completed on 9/9/2025
- BMP wattles were maintained below the 3.4-mile B-road bridge on 10/15/2025
- The Waste Rock Area E-pond bear fence was fixed on 11/19/2025 (Photo 1)
- Check dams near the 7.8-mile B-road culvert were maintained on 10/19/2025
- DB-01 and DB-02 were cleared of sediment on 10/26 and 10/27/2025
- A berm was installed on the east diversion ditch along the mill back slope on 11/19/2025
- The 1350 Portal sump was cleaned on 9/11/2025
- Additional labeling to the 920-portal spill kit was completed on 11/15/2025
- An engineering inspection was performed in the summer of 2025 with resurfacing of the 3.0- and 3.4-mile B-road bridge on the maintenance list for 2026.
- In the late summer and fall of 2025, the entrances to the portal bridge were filled with gravel to create an even surface for operating equipment. Continued maintenance of the portal bridge will occur in 2026.

No BMP plan revisions are necessary due to this inspection.

2.3. Agency Site Compliance Inspections

Personnel with the USDA Forest Service (USFS) perform routine inspections, typically monthly. Occasionally they will be accompanied by personnel from other regulatory agencies, including the Alaska Department of Natural Resources (ADNR) and Alaska Department of Fish and Game (ADFG). The purpose of the inspections is to evaluate compliance with HGCMC operating plans and permits. The scope of the inspections includes the 1350 area, 920 area, 860 area, Site 23/D, Site E, the Tailings Disposal Facility (TDF), inactive pits/quarries, and the entire A & B Road system. Inspection reports with photographs are prepared by the agencies to document conditions and observations and includes a list of action items to correct any noted deficiencies.

The table below lists the inspections performed in 2025 and includes the date of the inspection, and action items.

2025 Agency Compliance Inspections

| Date | Agency | Action Items |
|----------|--------|--|
| 13-Jan | USFS | No new action items. |
| 13-March | USFS | No new action items. |
| 12- June | USFS | Clean Gnome Ponds. 7.4 B-road Bridge liner torn. |

| | | |
|---------|------|---|
| 24-July | USFS | 3.4 and 3.0 B-road Bridge liner not functioning properly. |
| 28-Aug | USFS | 3.4 and 3.0 B-road Bridge liner not functioning properly. |
| 11-Sept | USFS | 3.4 and 3.0 B-road Bridge liner not functioning properly. |
| 30-Oct | USFS | 3.4 and 3.0 B-road Bridge liner not functioning properly. |

Progress in 2025 included ditch repair, improvements to BMPs, and fugitive dust mitigation. The list below summarizes the 2025 work and improvements. A log of the BMP maintenance work is attached to this report. Photographs showing some of this work are included at the end of this report.

- **Hydroseeding and BMP installation:**
Hydroseeding is conducted after ditch clean out and BMP maintenance along the HGCMC access road. Hydroseeding of the ditches around 7.4-mile B-road post ditch maintenance was performed (see photo 2) to establish vegetation for stabilization. BMPs were reinstalled under the 7.4-mile B-road bridge to reduce sediment from the gravel road from entering the creek.
- **BMP Maintenance at 3-mile B-road:**
Perform maintenance at outfall at 3.0-mile B-road with fresh wattles and stakes while removing built up sediment.
- **Flocculant Log Installation:**
Flocculant logs were deployed for turbidity control along the roadside stormwater BMPs adjacent to the 3.0-mile B-Road.
- **Road Maintenance:**
Utilize road grader equipment to keep gravel road gently angled towards ditches and swales established to divert road runoff to appropriate culverts and drains. A brusher attachment is used on road surfaces to minimize the potential for road dust release and the clogging of drains and culverts.
- **Ore-Pad Entrance Maintenance:**
Maintain swale at the ore pad entrance at the 920 to divert water runoff to DB-09 (degrit basin). Maintain tidiness of ore pad pile to minimize tracking.
- **B-Road Ditch Maintenance and Stabilization:**
Ditch repair, maintenance and stabilization activities began as soon as snowmelt and ground thaw allowed and continued throughout the summer and fall. After sections of the ditch were maintained, they were hydroseeded to establish vegetation for stabilization.
- **Sediment Sump and Culvert Maintenance:**
Sediment sumps and culverts along the B-Road were cleaned multiple times throughout 2025. The sediment was removed via vac truck or vac trailer and placed at the respective locations, TDF, ore pad, site 23, etc.
- **920 Area Belzona Concrete work:**
Repair concrete within the 920 area at the mine site to ensure an impermeable surface for operations (Photos 7 & 8).
- **Site E Waste Rock Removal:**
19,968 tons of waste rock was removed from Site E and placed into tails at the TDF (Photo 9).
- **Fugitive Dust Mitigation:**
HGCMC continued implementing measures throughout 2025 to reduce fugitive dust from the TDF. Excavated sediments from the B-Road ditch maintenance were hauled to the TDF and used to cap areas that were not going to be used for active tailings placement for an extended period. Portable wind screens were maintained along the south embankment road, along the crests of the TDF and

east side of the facility (Photo 3). In September of 2025, a severe windstorm broke and knocked down the permanent wind fence on the southern access road to the water treatment plant at the TDF (See photo 4). The HGCMC staff are researching a new path forward for a more efficient and sustainable wind fence. A water truck was also used as needed in accessible areas to control dust. Concrete jerseys are strategically placed as wind breaks. Logs from trees that were cut during the previous TDF expansion were placed around the facility to provide additional wind breaks. Chemical dust suppressants (such as Magnesium Chloride (MgCl) and Gorilla Snot) were added to the TDF where and when applicable (Photo 5). Limiting snow removal to only active placement areas. Inactive surfaces are covered with rock, sand, or other material. Utilize truck wheel-wash facility after equipment has entered the TDF to minimize tracked material. Track walking of active TDF slopes to reduce the potential for sediment erosion and mobilization (Photo 6).

2.4. HGCMC Monthly Evaluations and Site Inspections

HGCMC environmental staff members conduct weekly, monthly and quarterly visual inspections of a variety of areas within the mine site to identify any issues with housekeeping, material storage areas, or potential breaches that may lead to pollutants entering the permitted outfalls, storm water drainage system, or surface waters. Any corrective actions needed to address findings from the inspections are conducted with coordination between the environmental department staff, the maintenance department staff, or the surface operations department staff. Bridge maintenance for the 3.0, 3.4, 7.4-mile B-road, and the portal bridge were found and are on the work list for 2026.

3. BMP PLAN MODIFICATIONS IN 2025

The HGCMC BMP Plan addresses all components and facilities associated with the Greens Creek Mine. The BMP Plan is a “living” document subject to frequent edits and revisions resulting from routine inspections and BMP modifications. The official copy is retained on-site.

In October of 2025, HGCMC updated the BMP plan to include specific language to comply with APDES Permit AK0043206 sections 2.2.4.3 (description of activities), 2.2.4.4.2 (Inventory of Exposed Materials), 2.2.4.5.8 (Comprehensive Site Compliance Evaluation recording and document storage) and APDES Appendix A 1.12.5 certification wording.

Photographs

Photo 1: Bear fence at Waste Rock Site E pond maintained.



Photo 2: Hydroseeding post ditch maintenance around 7.4-mile B-road.



Photo 3: Portable wind screens placed along the crests of the TDF.



Photo 4: Permanent wind fence on the southern access road of the TDF was broken during a severe windstorm in September 2025.



Photo 5: Use of chemical dust suppressants on the TDF to reduce fugitive dust generation.



Photo 6: Track walking of active TDF slopes to reduce the potential for sediment erosion and mobilization.



Photo 7: 920 Freight Area Belzona Concrete work.

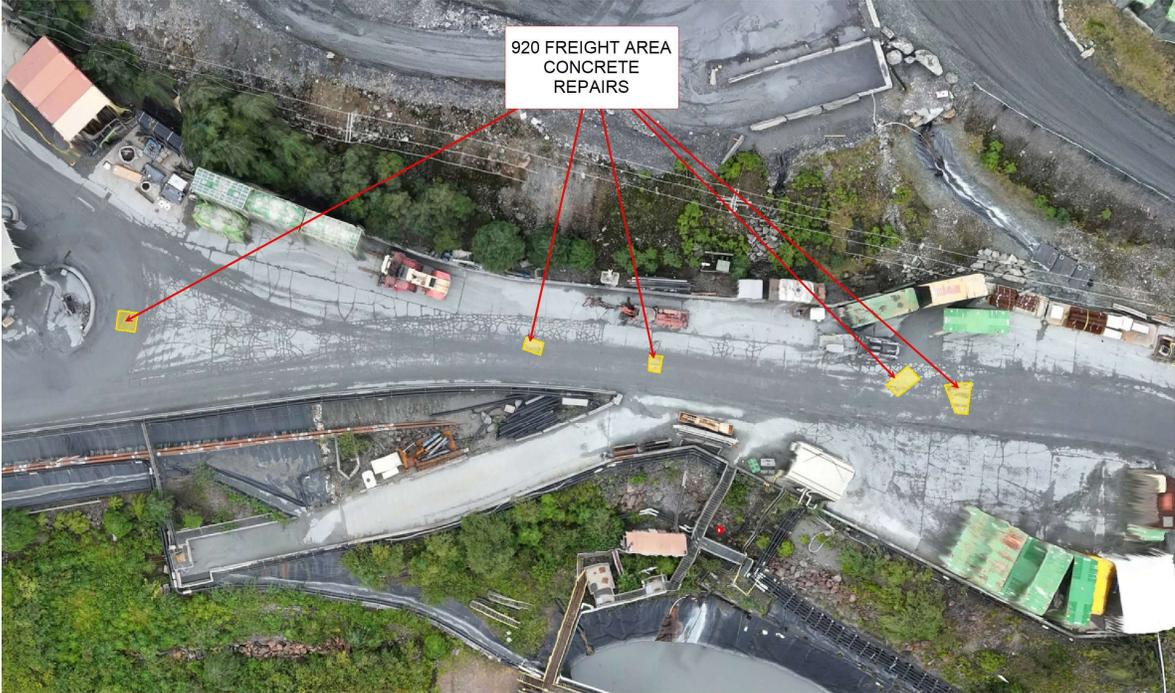


Photo 8: 920 Admin Area Belzona Concrete work.



Photo 9: 2025 Site E Waste Rock Removal for Placement on the TDF.



2025 BMP Maintenance Log

| Date | Location | Description of Activity |
|-----------|-------------------------|-------------------------|
| 1/1/2025 | Watered road | Water Truck Log |
| 1/8/2025 | DB10 | Degrit Basin Clean-out |
| 1/8/2025 | TAILS SUMPS | Degrit Basin Clean-out |
| 1/9/2025 | TAILS | Sediment Sweeping |
| 1/9/2025 | TAILS | Road Surfacing |
| 1/10/2025 | TAILS | Sediment Sweeping |
| 1/10/2025 | TAILS | Road Surfacing |
| 1/11/2025 | 920 | Sediment Sweeping |
| 1/11/2025 | 920 | Road Surfacing |
| 1/12/2025 | TAILS SUMPS/ CULVERTS | Degrit Basin Clean-out |
| 1/12/2025 | 920 | Sediment Sweeping |
| 1/12/2025 | 920 | Road Surfacing |
| 1/13/2025 | BEACH SUMPS | Degrit Basin Clean-out |
| 1/13/2025 | PORTAL SUMPS | Degrit Basin Clean-out |
| 1/13/2025 | 920 SHOP SUMP | Degrit Basin Clean-out |
| 1/15/2025 | DB01 | Degrit Basin Clean-out |
| 1/15/2025 | 920 DRAINS | Degrit Basin Clean-out |
| 1/15/2025 | TAILS | Sediment Sweeping |
| 1/15/2025 | TAILS | Road Surfacing |
| 1/16/2025 | 920 WATERFALLS | Degrit Basin Clean-out |
| 1/16/2025 | 1.2 & 0.85 STORM DRAINS | Degrit Basin Clean-out |
| 1/16/2025 | POND 7 CULVERTS | Degrit Basin Clean-out |
| 2/3/2025 | Watered road | Water Truck Log |
| 2/4/2025 | Watered road | Water Truck Log |
| 2/5/2025 | Watered road | Water Truck Log |
| 2/6/2025 | Watered road | Water Truck Log |
| 2/9/2025 | Watered road | Water Truck Log |
| 2/10/2025 | Watered road | Water Truck Log |
| 2/11/2025 | Watered road | Water Truck Log |
| 2/13/2025 | Watered road | Water Truck Log |
| 2/13/2025 | TAILS | Sediment Sweeping |
| 2/13/2025 | TAILS | Road Surfacing |
| 2/14/2025 | Watered road | Water Truck Log |
| 2/15/2025 | Watered road | Water Truck Log |
| 2/16/2025 | Watered road | Water Truck Log |
| 2/25/2025 | TAILS SUMP / CULVERTS | Degrit Basin Clean-out |
| 3/3/2025 | TAILS SUMPS | Degrit Basin Clean-out |
| 3/5/2025 | ROADSIDE SUMPS | Degrit Basin Clean-out |

| | | |
|-----------|----------------------|------------------------|
| 3/5/2025 | BEACH SUMPS | Degrit Basin Clean-out |
| 3/5/2025 | 920 | Sediment Sweeping |
| 3/5/2025 | 920 | Road Surfacing |
| 3/6/2025 | 1.3 TANK | Degrit Basin Clean-out |
| 3/6/2025 | ROADSIDE SUMPS | Degrit Basin Clean-out |
| 3/6/2025 | 920 | Sediment Sweeping |
| 3/6/2025 | 920 | Road Surfacing |
| 3/7/2025 | B ROAD | Ditching |
| 3/7/2025 | BEACH | Sediment Sweeping |
| 3/7/2025 | TAILS | Sediment Sweeping |
| 3/7/2025 | 920 | Sediment Sweeping |
| 3/7/2025 | BEACH | Road Surfacing |
| 3/7/2025 | TAILS | Road Surfacing |
| 3/7/2025 | 920 | Road Surfacing |
| 3/8/2025 | 920 | Sediment Sweeping |
| 3/8/2025 | 920 | Road Surfacing |
| 3/10/2025 | TAILS | Sediment Sweeping |
| 3/10/2025 | TAILS | Road Surfacing |
| 3/11/2025 | TAILS | Sediment Sweeping |
| 3/11/2025 | TAILS | Road Surfacing |
| 3/12/2025 | 3.2 SUMPS | Degrit Basin Clean-out |
| 3/12/2025 | DB01 | Degrit Basin Clean-out |
| 3/12/2025 | 920 | Sediment Sweeping |
| 3/12/2025 | 920 | Road Surfacing |
| 3/13/2025 | Watered road | Water Truck Log |
| 3/13/2025 | POND 7 CULVERTS | Degrit Basin Clean-out |
| 3/13/2025 | 920 BOOT WASH | Degrit Basin Clean-out |
| 3/13/2025 | SITE 23 | Degrit Basin Clean-out |
| 3/14/2025 | Watered road | Water Truck Log |
| 3/15/2025 | Watered road | Water Truck Log |
| 3/16/2025 | Watered road | Water Truck Log |
| 4/2/2025 | 3-3.4 ROADSIDE SUMPS | Degrit Basin Clean-out |
| 4/3/2025 | Watered road | Water Truck Log |
| 4/4/2025 | Watered road | Water Truck Log |
| 4/5/2025 | 1.3 WHEEL WASH | Degrit Basin Clean-out |
| 4/5/2025 | 920 | Sediment Sweeping |
| 4/5/2025 | 920 | Road Surfacing |
| 4/6/2025 | DB04 | Degrit Basin Clean-out |
| 4/6/2025 | 920 | Sediment Sweeping |
| 4/6/2025 | 920 | Road Surfacing |
| 4/8/2025 | UNDER PORTAL BRIDGE | Degrit Basin Clean-out |

| | | |
|-----------|---|------------------------|
| 4/9/2025 | 7.4 & 3.4 BRIDGES | Sediment Sweeping |
| 4/9/2025 | TAILS | Sediment Sweeping |
| 4/9/2025 | 7.4 & 3.4 BRIDGES | Road Surfacing |
| 4/9/2025 | TAILS | Road Surfacing |
| 4/10/2025 | Watered road | Water Truck Log |
| 4/10/2025 | PORTAL BRIDGE | Sediment Sweeping |
| 4/10/2025 | 3 MILE BRIDGE | Sediment Sweeping |
| 4/10/2025 | PORTAL BRIDGE | Road Surfacing |
| 4/10/2025 | 3 MILE BRIDGE | Road Surfacing |
| 4/11/2025 | BEACH | Degrit Basin Clean-out |
| 4/11/2025 | 920 SUMPS | Degrit Basin Clean-out |
| 4/12/2025 | 920 WATERFALLS | Degrit Basin Clean-out |
| 4/12/2025 | 920 STORM DRAINS | Degrit Basin Clean-out |
| 4/12/2025 | SITE 23 SUMP | Degrit Basin Clean-out |
| 4/13/2025 | DB02 | Degrit Basin Clean-out |
| 4/13/2025 | 3 MILE SUMPS | Degrit Basin Clean-out |
| 4/13/2025 | 920 POWERHOUSE | Degrit Basin Clean-out |
| 4/18/2025 | 6.6 - 7.8 | Hydroseed |
| 4/19/2025 | Watered road | Water Truck Log |
| 4/19/2025 | 6.2 - 6.6 / 3 | Hydroseed |
| 4/20/2025 | Watered road | Water Truck Log |
| 4/20/2025 | 6.0 - 6.5 / 7.2 - 7.4 / 860 - 920 | Hydroseed |
| 4/21/2025 | Watered road | Water Truck Log |
| 4/21/2025 | 6.0-5.6 | Hydroseed |
| 4/21/2025 | 5.6-4.0 | Hydroseed |
| 4/22/2025 | 7.2 slide, 4.4-4.7, under 3-mile bridge | Hydroseed |
| 4/23/2025 | B ROAD | Hydroseed |
| 4/26/2025 | Watered road | Water Truck Log |
| 4/30/2025 | Watered road | Water Truck Log |
| 4/30/2025 | DB04 | Degrit Basin Clean-out |
| 4/30/2025 | TAILS | Sediment Sweeping |
| 4/30/2025 | TAILS | Road Surfacing |
| 4/30/2025 | DB08 | Degrit Basin Clean-out |
| 5/1/2025 | TAILS | Sediment Sweeping |
| 5/1/2025 | TAILS | Road Surfacing |
| 5/2/2025 | TAILS SUMPS | Degrit Basin Clean-out |
| 5/4/2025 | BD08 | Degrit Basin Clean-out |
| 5/4/2025 | TAILS | Sediment Sweeping |
| 5/4/2025 | TAILS | Road Surfacing |

| | | |
|-----------|---------------------------|------------------------|
| 5/11/2025 | Watered road | Water Truck Log |
| 5/12/2025 | Watered road | Water Truck Log |
| 5/13/2025 | 3.2 SUMPS | Degrit Basin Clean-out |
| 5/14/2025 | 3.1 SUMPS | Degrit Basin Clean-out |
| 5/18/2025 | Watered road | Water Truck Log |
| 5/19/2025 | Watered road | Water Truck Log |
| 5/22/2025 | Watered road | Water Truck Log |
| 5/23/2025 | Watered road | Water Truck Log |
| 5/23/2025 | West tails sump | Degrit Basin Clean-out |
| 5/27/2025 | PORTAL SUMPS/DB01 | Degrit Basin Clean-out |
| 5/27/2025 | POND 7 CULVERTS | Degrit Basin Clean-out |
| 5/27/2025 | 1 MILE HILL SUMPS | Degrit Basin Clean-out |
| 5/27/2025 | BEACH SUMPS | Degrit Basin Clean-out |
| 5/27/2025 | 920 | Sediment Sweeping |
| 5/27/2025 | 920 | Sediment Sweeping |
| 5/27/2025 | 920 | Road Surfacing |
| 5/27/2025 | 920 | Road Surfacing |
| 5/28/2025 | B ROAD | Ditching |
| 5/28/2025 | DB01/7.8 | Degrit Basin Clean-out |
| 5/28/2025 | 0.8 CULVERTS SEDIMENT | Degrit Basin Clean-out |
| 5/29/2025 | UNDER 7.4 BRIDGE | Hydroseed |
| 5/29/2025 | B ROAD | Ditching |
| 5/29/2025 | WHEEL WASH | Degrit Basin Clean-out |
| 5/29/2025 | 1.3 TANK | Degrit Basin Clean-out |
| 5/30/2025 | B ROAD | Ditching |
| 5/30/2025 | TAILS SUMPS | Degrit Basin Clean-out |
| 5/30/2025 | DB10 | Degrit Basin Clean-out |
| 5/30/2025 | 7.4,3.4- & 3-MILE BRIDGES | Sediment Sweeping |
| 5/30/2025 | 7.4,3.4- & 3-MILE BRIDGES | Road Surfacing |
| 5/31/2025 | 1.3- 5.3 | Hydroseed |
| 5/31/2025 | A/B ROAD | Ditching |
| 6/1/2025 | A/B ROAD | Ditching |
| 6/3/2025 | Watered road | Water Truck Log |
| 6/3/2025 | 920 SUMPS | Degrit Basin Clean-out |
| 6/3/2025 | BEACH | Degrit Basin Clean-out |
| 6/3/2025 | TAILS | Sediment Sweeping |
| 6/3/2025 | TAILS | Road Surfacing |
| 6/4/2025 | Watered road | Water Truck Log |
| 6/6/2025 | Watered road | Water Truck Log |
| 6/9/2025 | Watered road | Water Truck Log |
| 6/10/2025 | Watered road | Water Truck Log |

| | | |
|-----------|-------------------------------|------------------------|
| 6/11/2025 | Watered road | Water Truck Log |
| 6/12/2025 | Watered road | Water Truck Log |
| 6/13/2025 | Watered road | Water Truck Log |
| 6/14/2025 | Watered road | Water Truck Log |
| 6/17/2025 | Watered road | Water Truck Log |
| 6/20/2025 | Watered road | Water Truck Log |
| 6/21/2025 | Watered road | Water Truck Log |
| 6/22/2025 | Watered road | Water Truck Log |
| 6/23/2025 | Watered road | Water Truck Log |
| 6/25/2025 | 3.2 SUMPS | Degrit Basin Clean-out |
| 6/25/2025 | POND 7 CULVERTS | Degrit Basin Clean-out |
| 6/25/2025 | 1.3 TANK | Degrit Basin Clean-out |
| 6/28/2025 | 920 | Sediment Sweeping |
| 6/28/2025 | 920 | Road Surfacing |
| 6/29/2025 | TAILS | Sediment Sweeping |
| 6/29/2025 | TAILS | Road Surfacing |
| 7/3/2025 | Watered road | Water Truck Log |
| 7/3/2025 | A ROAD | Hydroseed |
| 7/4/2025 | Watered road | Water Truck Log |
| 7/4/2025 | A ROAD | Hydroseed |
| 7/5/2025 | Watered road | Water Truck Log |
| 7/8/2025 | 3 MILE SUMPS, 4.8 BROAD SUMP | Degrit Basin Clean-out |
| 7/9/2025 | B ROAD/ORE PAD HILL | Degrit Basin Clean-out |
| 7/9/2025 | 920 SUMPS | Degrit Basin Clean-out |
| 7/10/2025 | DB04 | Degrit Basin Clean-out |
| 7/10/2025 | 1.3 WHEELWASH, 4.8 BROAD SUMP | Degrit Basin Clean-out |
| 7/12/2025 | Watered road | Water Truck Log |
| 7/13/2025 | Watered road | Water Truck Log |
| 7/14/2025 | Watered road | Water Truck Log |
| 7/15/2025 | Watered road | Water Truck Log |
| 7/16/2025 | Watered road | Water Truck Log |
| 7/17/2025 | Watered road | Water Truck Log |
| 7/18/2025 | Watered road | Water Truck Log |
| 7/19/2025 | Watered road | Water Truck Log |
| 7/20/2025 | Watered road | Water Truck Log |
| 7/21/2025 | Watered road | Water Truck Log |
| 7/22/2025 | Watered road | Water Truck Log |
| 7/25/2025 | Watered road | Water Truck Log |
| 7/26/2025 | Watered road | Water Truck Log |
| 7/27/2025 | Watered road | Water Truck Log |

| | | |
|-----------|------------------|------------------------|
| 7/28/2025 | Watered road | Water Truck Log |
| 7/30/2025 | Watered road | Water Truck Log |
| 7/30/2025 | POWERHOUSE SUMPS | Degrit Basin Clean-out |
| 8/2/2025 | Watered road | Water Truck Log |
| 8/4/2025 | Watered road | Water Truck Log |
| 8/5/2025 | Watered road | Water Truck Log |
| 8/6/2025 | Watered road | Water Truck Log |
| 8/7/2025 | Watered road | Water Truck Log |
| 8/12/2025 | Watered road | Water Truck Log |
| 8/13/2025 | Watered road | Water Truck Log |
| 8/14/2025 | Watered road | Water Truck Log |
| 8/15/2025 | Watered road | Water Truck Log |
| 8/15/2025 | BATCH PLANT SUMP | Degrit Basin Clean-out |
| 8/16/2025 | Watered road | Water Truck Log |
| 8/18/2025 | Watered road | Water Truck Log |
| 8/19/2025 | Watered road | Water Truck Log |
| 8/20/2025 | Watered road | Water Truck Log |
| 8/21/2025 | Watered road | Water Truck Log |
| 8/22/2025 | Watered road | Water Truck Log |
| 8/23/2025 | Watered road | Water Truck Log |
| 8/24/2025 | Watered road | Water Truck Log |
| 8/25/2025 | Watered road | Water Truck Log |
| 8/26/2025 | Watered road | Water Truck Log |
| 8/27/2025 | Watered road | Water Truck Log |
| 8/28/2025 | Watered road | Water Truck Log |
| 8/29/2025 | Watered road | Water Truck Log |
| 8/30/2025 | Watered road | Water Truck Log |
| 8/31/2025 | Watered road | Water Truck Log |
| 9/1/2025 | Watered road | Water Truck Log |
| 9/2/2025 | Watered road | Water Truck Log |
| 9/7/2025 | Watered road | Water Truck Log |
| 9/8/2025 | Watered road | Water Truck Log |
| 9/9/2025 | 3-mile sumps | Degrit Basin Clean-out |
| 9/10/2025 | 3-mile sumps | Degrit Basin Clean-out |
| 9/11/2025 | 920 SUMPS | Degrit Basin Clean-out |
| 9/11/2025 | TAILS | Sediment Sweeping |
| 9/11/2025 | TAILS | Road Surfacing |
| 9/13/2025 | Watered road | Water Truck Log |
| 9/13/2025 | 1.3 WHEEL WASH | Degrit Basin Clean-out |
| 9/14/2025 | Watered road | Water Truck Log |
| 9/15/2025 | DB03 | Degrit Basin Clean-out |

| | | |
|------------|---------------------|------------------------|
| 9/15/2025 | TAILS | Sediment Sweeping |
| 9/15/2025 | 920 | Sediment Sweeping |
| 9/15/2025 | TAILS | Road Surfacing |
| 9/15/2025 | 920 | Road Surfacing |
| 9/16/2025 | DB03 | Degrit Basin Clean-out |
| 9/16/2025 | TAILS SUMPS | Degrit Basin Clean-out |
| 9/16/2025 | DB10 | Degrit Basin Clean-out |
| 9/22/2025 | POWERHOUSE SUMP | Degrit Basin Clean-out |
| 9/22/2025 | TAILS | Sediment Sweeping |
| 9/22/2025 | TAILS | Road Surfacing |
| 9/24/2025 | BEACH SUMPS | Degrit Basin Clean-out |
| 9/24/2025 | BOTTOM ORE PAD SUMP | Degrit Basin Clean-out |
| 9/24/2025 | 3.2 ROADSIDE SUMPS | Degrit Basin Clean-out |
| 9/24/2025 | TAILS | Sediment Sweeping |
| 9/24/2025 | TAILS | Road Surfacing |
| 9/30/2025 | Watered road | Water Truck Log |
| 10/1/2025 | 1.3 WW | Degrit Basin Clean-out |
| 10/2/2025 | 1.3 WW | Degrit Basin Clean-out |
| 10/12/2025 | Watered road | Water Truck Log |
| 10/14/2025 | Watered road | Water Truck Log |
| 10/14/2025 | TAILS | Sediment Sweeping |
| 10/14/2025 | TAILS | Road Surfacing |
| 10/15/2025 | ROADSIDE SUMPS | Degrit Basin Clean-out |
| 10/17/2025 | Watered road | Water Truck Log |
| 10/18/2025 | 920 LINED DITCHES | Degrit Basin Clean-out |
| 10/18/2025 | TAILS | Sediment Sweeping |
| 10/18/2025 | TAILS | Road Surfacing |
| 10/19/2025 | 920 SUMPS | Degrit Basin Clean-out |
| 10/20/2025 | 920 | Sediment Sweeping |
| 10/20/2025 | 920 | Road Surfacing |
| 10/26/2025 | Watered road | Water Truck Log |
| 10/26/2025 | DB01 | Degrit Basin Clean-out |
| 10/27/2025 | DB02 | Degrit Basin Clean-out |
| 10/28/2025 | DB04 | Degrit Basin Clean-out |
| 11/12/2025 | 920 SUMPS | Degrit Basin Clean-out |
| 11/16/2025 | Watered road | Water Truck Log |
| 11/17/2025 | 1.3 WHEEL WASH | Degrit Basin Clean-out |
| 11/18/2025 | 920 | Sediment Sweeping |
| 11/18/2025 | TAILS | Sediment Sweeping |
| 11/18/2025 | 920 | Road Surfacing |
| 11/18/2025 | TAILS | Road Surfacing |

| | | |
|------------|---------------------|-------------------|
| 11/19/2025 | 920 | Sediment Sweeping |
| 11/19/2025 | 920 | Road Surfacing |
| 11/21/2025 | Watered road | Water Truck Log |
| 11/22/2025 | 3,3.4 & 7.4 Bridges | Sediment Sweeping |
| 11/22/2025 | PORTAL BRIDGE | Sediment Sweeping |
| 11/22/2025 | 3,3.4 & 7.4 Bridges | Road Surfacing |
| 11/22/2025 | PORTAL BRIDGE | Road Surfacing |
| 11/24/2025 | Watered road | Water Truck Log |
| 11/27/2025 | Watered road | Water Truck Log |
| 11/28/2025 | Watered road | Water Truck Log |